


24 667 000 TALIA 3-HOLE BIDET MIXER

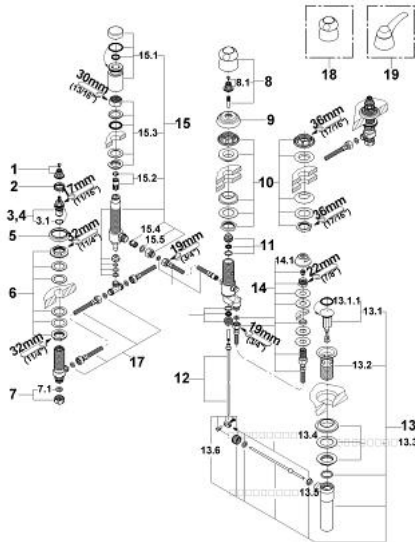


SPARE PARTS, January 1994 – now

- 1: Replacement handle connection kit (Spare part-nr. 45186000)
- 1.1: O-ring $\varnothing 18.2 \times \varnothing 1.7$ (Spare part-nr. 0392400M)
- 2: Ring (Spare part-nr. 03070000)
- 3: Ceramic headpart, 1/2" (Spare part-nr. 45882000)
- 3.1: O-ring $\varnothing 18.2 \times \varnothing 1.7$ (Spare part-nr. 0392400M)
- 4: Ceramic headpart, 1/2" (Spare part-nr. 45883000)
- 4.1: O-ring $\varnothing 18.2 \times \varnothing 1.7$ (Spare part-nr. 0392400M)
- 5: Escutcheon (Spare part-nr. 45822000)
- 6: Shank fastening assembly (Spare part-nr. 45025000)
- 7: Coupling nut 1/2" x 14.5 mm (Spare part-nr. 1290200M)
- 7.1: Fibre seal dia. 12x2 mm (Spare part-nr. 0138900M)
- 8: Repl.kit f.diverter handle (Spare part-nr. 45799000)
- 8.1: Replacement handle connection kit (Spare part-nr. 45186000)
- 9: Escutcheon (Spare part-nr. 02281000)
- 10: Screw connection for bidet body (Spare part-nr. 45026000)
- 11: Repl. kit f. seal (Spare part-nr. 45027000)
- 12: Jointed rod (Spare part-nr. 06085000)
- 13: Pop-up waste set (Spare part-nr. 28957000)
- 13.1: Plug (Spare part-nr. 45324000)
- 13.2: Housing (Spare part-nr. 01153000)
- 13.3: Ball rod (Spare part-nr. 45264000)
- 14: Rim spray (Spare part-nr. 24210000)
- 14.1: Spray faceplate (Spare part-nr. 02664000)
- 15: Vacuum Breaker (Spare part-nr. 45852000)
- 15.1: Shank mounting kit (Spare part-nr. 45855000)
- 15.2: Non-return valve (Spare part-nr. 08565000)
- 15.3: Fibre seal dia. 12x2 mm (Spare part-nr. 0138900M)
- 16: Connection hose (Spare part-nr. 46255000)
- 17: Flexible connection hose (Spare part-nr. 45704000)
- 18: Handle (Spare part-nr. 45818000)*
- 19: Lever (Spare part-nr. 45820000)*

* Optional accessories


24 667 000 TALIA 3-HOLE BIDET MIXER

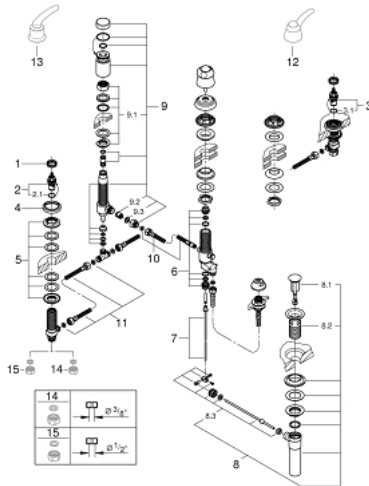

SPARE PARTS, August 2016 – now

- 1: Ring (Spare part-nr. 03070000)
 - 2: Ceramic headpart, 1/2" (Spare part-nr. 45882000)
 - 2.1: O-ring $\varnothing 18.2 \times \varnothing 1.7$ (Spare part-nr. 0392400M)
 - 3: Ceramic headpart, 1/2" (Spare part-nr. 45883000)
 - 3.1: O-ring $\varnothing 18.2 \times \varnothing 1.7$ (Spare part-nr. 0392400M)
 - 4: Escutcheon (Spare part-nr. 45822000)
 - 5: Shank fastening assembly (Spare part-nr. 45025000)
 - 6: Repl. kit f. seal (Spare part-nr. 45027000)
 - 7: Jointed rod (Spare part-nr. 06085000)
 - 8: Pop-up waste set (Spare part-nr. 28957000)
 - 8.1: Plug (Spare part-nr. 45324000)
 - 8.2: Housing (Spare part-nr. 01153000)
 - 8.3: Ball rod (Spare part-nr. 45264000)
 - 9: Vacuum Breaker (Spare part-nr. 45852000)
 - 9.1: Shank mounting kit (Spare part-nr. 45855000)
 - 9.2: Non-return valve (Spare part-nr. 08565000)
 - 9.3: Fibre seal dia. 12x2 mm (Spare part-nr. 0138900M)
 - 10: Connection hose (Spare part-nr. 46255000)
 - 11: Flexible connection hose (Spare part-nr. 45704000)
 - 12: Talia lever handle (Spare part-nr. 18077000)*
 - 13: Talia metal handle, pair (Spare part-nr. 18085000)*
 - 14: Coupling nut 1/2" x 10.5 mm (Spare part-nr. 1290100M)*
 - 15: Coupling nut 1/2" x 14.5 mm (Spare part-nr. 1290200M)*
- * Optional accessories

24 667 000 TALIA 3-HOLE BIDET MIXER

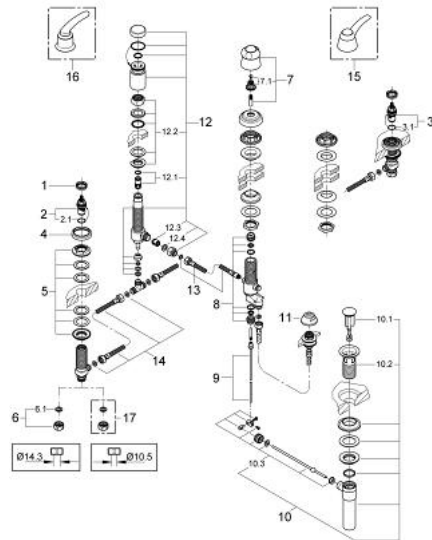


SPARE PARTS, December 2013 – August 2016

- 1: Ring (Spare part-nr. 03070000)
- 2: Ceramic headpart, 1/2" (Spare part-nr. 45882000)
- 2.1: O-ring $\varnothing 18.2 \times \varnothing 1.7$ (Spare part-nr. 0392400M)
- 3: Ceramic headpart, 1/2" (Spare part-nr. 45883000)
- 3.1: O-ring $\varnothing 18.2 \times \varnothing 1.7$ (Spare part-nr. 0392400M)
- 4: Escutcheon (Spare part-nr. 45822000)
- 5: Shank fastening assembly (Spare part-nr. 45025000)
- 6: Coupling nut 1/2" x 14.5 mm (Spare part-nr. 1290200M)
- 6.1: Fibre seal dia. 12x2 mm (Spare part-nr. 0138900M)
- 7: Handle (Spare part-nr. 45818000)
- 7.1: Replacement handle connection kit (Spare part-nr. 45186000)
- 8: Repl. kit f. seal (Spare part-nr. 45027000)
- 9: Jointed rod (Spare part-nr. 06085000)
- 10: Pop-up waste set (Spare part-nr. 28957000)
- 10.1: Plug (Spare part-nr. 45324000)
- 10.2: Housing (Spare part-nr. 01153000)
- 10.3: Ball rod (Spare part-nr. 45264000)
- 11: Spray faceplate (Spare part-nr. 02664000)
- 12: Vacuum Breaker (Spare part-nr. 45852000)
- 12.1: Shank mounting kit (Spare part-nr. 45855000)
- 12.2: Non-return valve (Spare part-nr. 08565000)
- 12.3: Fibre seal dia. 12x2 mm (Spare part-nr. 0138900M)
- 13: Connection hose (Spare part-nr. 46255000)
- 14: Flexible connection hose (Spare part-nr. 45704000)
- 15: Talia lever handle (Spare part-nr. 18077000)*
- 16: Talia metal handle, pair (Spare part-nr. 18085000)*
- 17: Coupling nut 1/2" x 10.5 mm (Spare part-nr. 1290100M)*

* Optional accessories

24 667 000 TALIA 3-HOLE BIDET MIXER

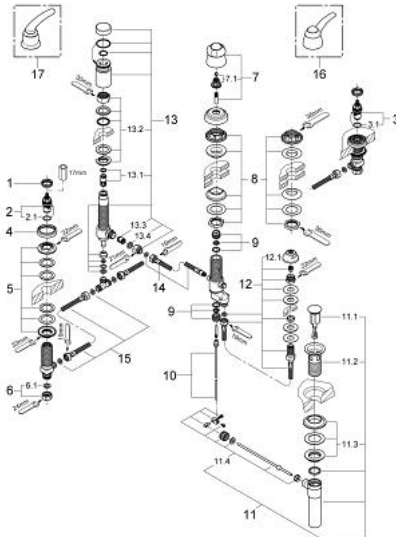


SPARE PARTS, June 2007 – December 2013

- 1: Ring (Spare part-nr. 03070000)
- 2: Ceramic headpart, 1/2" (Spare part-nr. 45882000)
- 2.1: O-ring $\varnothing 18.2 \times \varnothing 1.7$ (Spare part-nr. 0392400M)
- 3: Ceramic headpart, 1/2" (Spare part-nr. 45883000)
- 3.1: O-ring $\varnothing 18.2 \times \varnothing 1.7$ (Spare part-nr. 0392400M)
- 4: Escutcheon (Spare part-nr. 45822000)
- 5: Shank fastening assembly (Spare part-nr. 45025000)
- 6: Coupling nut 1/2" x 14.5 mm (Spare part-nr. 1290200M)
- 6.1: Fibre seal dia. 12x2 mm (Spare part-nr. 0138900M)
- 7: Handle (Spare part-nr. 45818000)
- 7.1: Replacement handle connection kit (Spare part-nr. 45186000)
- 8: Screw connection for bidet body (Spare part-nr. 45026000)
- 9: Repl. kit f. seal (Spare part-nr. 45027000)
- 10: Jointed rod (Spare part-nr. 06085000)
- 11: Pop-up waste set (Spare part-nr. 28957000)
- 11.1: Plug (Spare part-nr. 45324000)
- 11.2: Housing (Spare part-nr. 01153000)
- 11.3: Ball rod (Spare part-nr. 45264000)
- 12: Rim spray (Spare part-nr. 24210000)
- 12.1: Spray faceplate (Spare part-nr. 02664000)
- 13: Vacuum Breaker (Spare part-nr. 45852000)
- 13.1: Double ball vacuum breaker (Spare part-nr. 45854000)
- 13.2: Shank mounting kit (Spare part-nr. 45855000)
- 13.3: Non-return valve (Spare part-nr. 08565000)
- 13.4: Fibre seal dia. 12x2 mm (Spare part-nr. 0138900M)
- 14: Connection hose (Spare part-nr. 46255000)
- 15: Flexible connection hose (Spare part-nr. 45704000)
- 16: Talia lever handle (Spare part-nr. 18077000)*
- 17: Talia metal handle, pair (Spare part-nr. 18085000)*

* Optional accessories

24 667 000 TALIA 3-HOLE BIDET MIXER

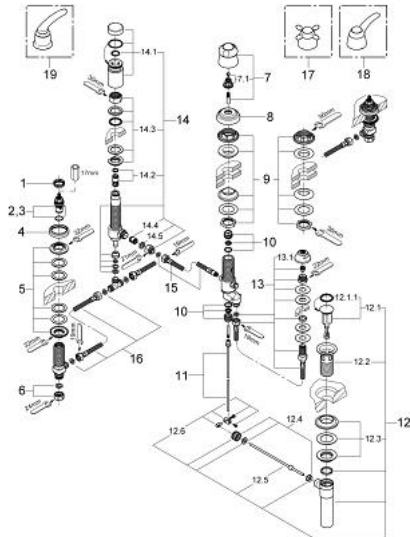

SPARE PARTS, May 2005 – June 2007

- 1: Ring (Spare part-nr. 03070000)
- 2: Ceramic headpart, 1/2" (Spare part-nr. 45882000)
- 3: Ceramic headpart, 1/2" (Spare part-nr. 45883000)
- 4: Escutcheon (Spare part-nr. 45822000)
- 5: Shank fastening assembly (Spare part-nr. 45025000)
- 6: Coupling nut 1/2" x 14.5 mm (Spare part-nr. 1290200M)
- 7: Repl.kit f.diverter handle (Spare part-nr. 45799000)
- 7.1: Replacement handle connection kit (Spare part-nr. 45186000)
- 8: Escutcheon (Spare part-nr. 02281000)
- 9: Screw connection for bidet body (Spare part-nr. 45026000)
- 10: Repl. kit f. seal (Spare part-nr. 45027000)
- 11: Jointed rod (Spare part-nr. 06085000)
- 12: Pop-up waste set (Spare part-nr. 28957000)
- 12.1: Plug (Spare part-nr. 45324000)
- 12.2: Housing (Spare part-nr. 01153000)
- 12.3: Mounting set (Spare part-nr. 45266000)
- 12.4: Ball rod (Spare part-nr. 45264000)
- 13: Rim spray (Spare part-nr. 24210000)
- 13.1: Spray faceplate (Spare part-nr. 02664000)
- 14: Vacuum Breaker (Spare part-nr. 45852000)
- 14.1: Double ball vacuum breaker (Spare part-nr. 45854000)
- 14.2: Shank mounting kit (Spare part-nr. 45855000)
- 14.3: Non-return valve (Spare part-nr. 08565000)
- 14.4: Fibre seal dia. 12x2 mm (Spare part-nr. 0138900M)
- 15: Connection hose (Spare part-nr. 46255000)
- 16: Flexible connection hose (Spare part-nr. 45704000)
- 17: Sinfonia cross handles (Spare part-nr. 18076000)*
- 18: Talia lever handle (Spare part-nr. 18077000)*
- 19: Talia metal handle, pair (Spare part-nr. 18085000)*

* Optional accessories